

LI-19



read-out unit

&

datalogger

with μV sensitivity

v 4.10

Introduction

The LI-19 is a low-cost, high-performance sensor readout unit with integrated datalogger.

The sensor sensitivity can be programmed into the LI-19 such that the readout will show calibrated engineering units, rather than millivolts or microvolts.

Use of the datalogger functions and programming the sensor sensitivity, requires a USB interface which is used to connect the LI-19 to a PC.

Specifications

A/D conversion	16 bits		
Input range (programmable)	Full scale voltage	Internal counts	Internal resolution
	+/- 200 mV	20,000	10 μ V
	+/- 100 mV	10,000	10 μ V
	+/- 50 mV	5,000	10 μ V
	+/- 25 mV	25,000	1 μ V
	+/- 12.5 mV	12,500	1 μ V
	+/- 6.25 mV	6,250	1 μ V
Basic accuracy after factory calibration	0.1%		
Temperature sensitivity	< 0.5% over the full temperature range		
Offset drift	< 3 μ V over the full temperature range		
Operation temperature range	-10 .. +40 °C		
Storage temperature range	-20 .. +60 °C		
Relative humidity	< 95% RH non-condensing		
Input circuit	> 2 M Ω // 680 nF		
Input low-pass filter	5 Hz		
Input connectors	2 x 4mm banana plug		
Display	LCD 4 digits with sign		
Decimal dot position (programmable)	8888 or 888.8 or 88.88 or 8.888		
Display update	At least 1 per second		
Computer interface	USB 1.1 / 2.0 low speed		
Supply current	< 2 mA		
Batteries	2 AA (penlight) alkaline		
Battery life (alkaline)	> 600 hours (25 days) continuous use		
Data logger memory	3518 samples		
Data logger storage interval	2 .. 65535 seconds		
Logged information	Min, max and average over log interval		
Software compatibility	Windows 2000, Windows XP, Windows Vista		

Operation

The LI-19 accepts two AA size (penlight) batteries. Use alkaline types for best results. New, good quality batteries should give up to 50 days of continuous operation.

Remove the bottom cover of the enclosure to access the battery compartment. Extract the battery holder from the compartment, and install two fresh batteries. Notice the polarization. Replace the bottom cover and connect the sensor. The LI-19 is now ready for use. Switch the LI-19 on with the push-button switch on the top.



To prevent that the LI-19 is switched off while logging, the on/off switch is mounted so that the button has to be pressed quite deep to switch the LI-19 on or off. You can feel it and hear it when the switch toggles. Press the small black button far enough with your nail or a pencil until you feel and hear it switch.

Software

Use of the software requires a PC with Windows 2000, XP or Vista operating system and a USB interface. The software has built-in functionality for:

- programming the sensor sensitivity
- data logging functions


For each of these functions, an interface cable is required. This cable is used to connect a LI-19 to the USB bus on a PC. If your LI-19 comes bundled with a sensor, it may be that your supplier already programmed the sensor sensitivity into the LI-19, and that this function is disabled in the software. In that case, the optional interface cable and the software give you access to the data logging functions only.

Main window

After installation, the software can be started from the Start menu. The main window allows you to open a previously stored file with logged data.



LI-19 window

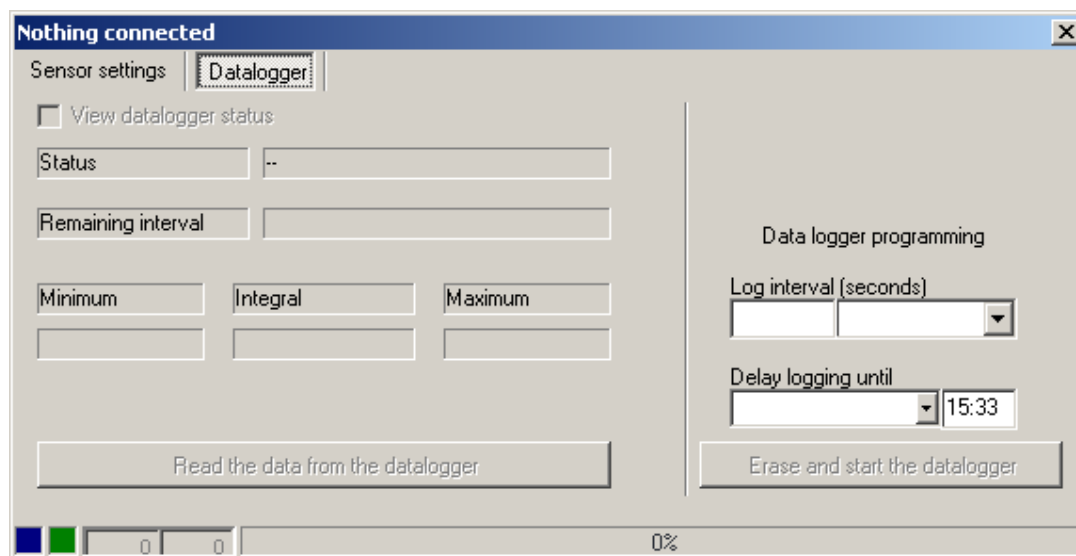


All other functions related to the LI-19 are available in special windows, that will open once you connect an LI-19 to the PC. You can connect more than one LI-19 to your PC, and for each of the devices a separate window will open. These windows may be on top of each other, move them around on your screen to reveal the ones that are covered.

Note that the buttons for 'Sensor settings' may not be available on your version of the software.

The PC will automatically detect the LI-19. If the PC does not detect the LI-19, then check if the LI-19 is switched on, and check the batteries.

Once the LI-19 is detected, the caption of the window will show the serial number of the LI-19 that was connected.

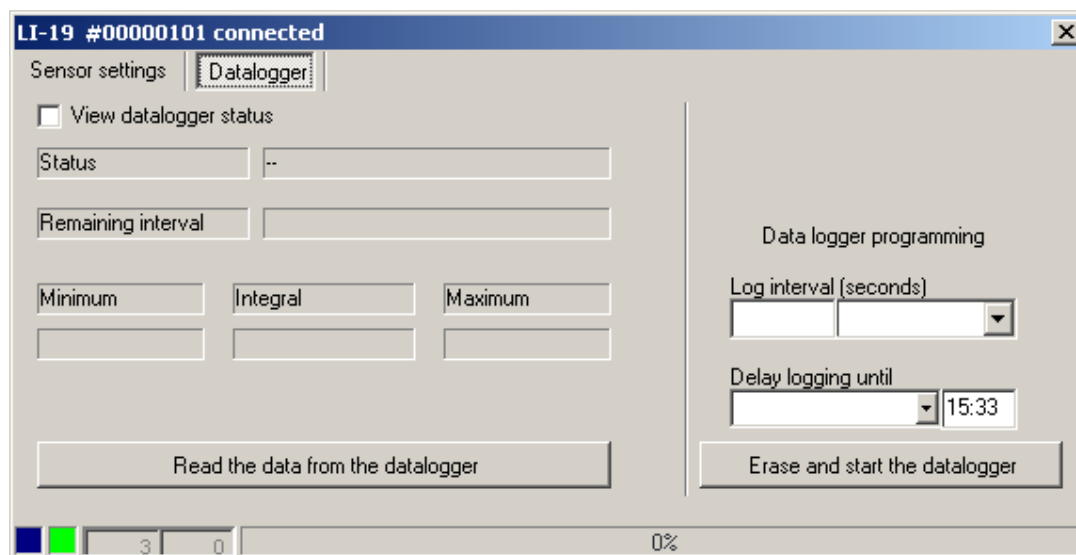


Programming the sensor sensitivity

The software is used to program the sensor sensitivity into the LI-19. If the LI-19 came bundled with a sensor, your supplier may already have programmed the sensitivity of this sensor into the LI-19. If that is the case, the software you received may not have this option.

Manually

If you want to manually enter the sensor settings, the required LI-19 setup is determined in the following steps:

1. Go to the 'Sensor settings' page. The full range output voltage of the sensor should be less than or equal to the full scale input voltage of the LI-19. The full range output voltage is used to select the maximum input stage amplification factor of the LI-19 in the software. In the box that says 'Input amplifier' you can select the amplification that corresponds to the required full scale input.

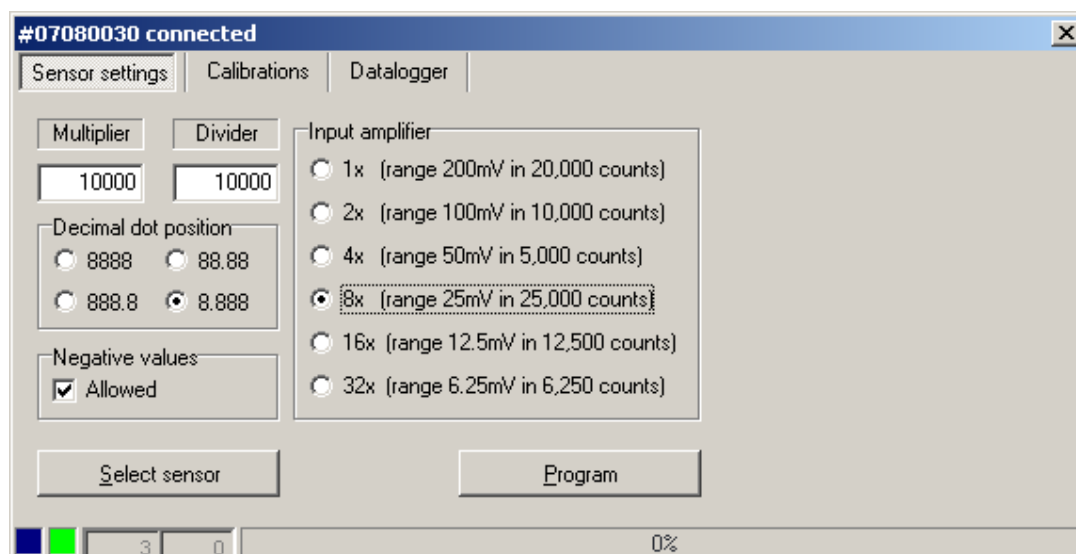

2. Next to the amplification factor, you can read how many internal counts each input range will give you. The number that the LI-19 should display at the full scale input value is entered into the multiplier input field. The number of internal counts that corresponds to that full scale input, is entered into the divider field.
3. The decimal dot position for the display is selected.
4. Tick the 'Allowed' checkbox for negative values if the sensor can measure values less than zero. If you do not tick this box, the LI-19 will clip all negative values to zero.
5. The LI-19 is ready to be programmed with the new settings. To do that, click the 'Program' button.

Some examples:

We have a sensor with a calibration factor of 12.38 mV/W/m^2 . We want to measure in a test-room where the light intensity is 100 W/m^2 max.

Step 1: Select the range on the 'Sensor settings' page. The full scale output of the sensor is:

$$12.38 \text{ mV/W/m}^2 \times 100 \text{ W/m}^2 = 123.8 \text{ mV}$$

This should fit the selected range, so the 200 mV range is the right choice.

Step 2: Determine the display reading. Enter the figure that the LI-19 should display at full scale in the multiplier field. You can use all 4 available digits, keeping in mind that we can add a decimal point later. So in this case we can enter 1000 for the full scale display value.

Enter the number of counts that correspond with the selected range (here 20000 counts) in the divider field.

The display will now show 1000 at 100 W/m^2 input on the sensor.

Step 3: Set the decimal point to 888.8. The display will then read 100.0 at 100 W/m^2 input on the sensor.

Step 4: Select if you want to see negative values or not.

Step 5: Program the setting into the LI-19.

One more example.

We have a sensor with a calibration factor of $4.56 \text{ } \mu\text{V/W/m}^2$. We want to measure in the open field where the maximum expected irradiance is 1100 W/m^2 .

Step 1: Select the range on the 'Sensor settings' page. The full scale output of the sensor is:

$$4.56 \text{ } \mu\text{V/W/m}^2 \times 1100 \text{ W/m}^2 = 5.016 \text{ mV}$$

This should fit the selected range, so the 6.25 mV range is the right choice.

Step 2: Determine the display reading. Enter the figure that the LI-19 should display at full scale in the multiplier field. You can use all 4 available digits, keeping in mind that we can add a decimal point later. So in this case we can enter 1100 for the full scale display value.

Enter the number of counts that correspond with the selected range (here 6250 counts) in the divider field.

The display will now show 1100 at 1100 W/m^2 input on the sensor.

Step 3: Set the decimal point to 8888. The display will then read 1100 at 1100 W/m² input on the sensor.


Step 4: Select if you want to see negative values or not.

Step 5: Program the setting into the LI-19.

Wizard

Alternatively, the settings are generated by software through the Wizard. Depending on the sensor sensitivity, the Wizard will select the optimal input stage amplification for the LI-19, and store appropriate values in the multiplier and divider fields. The position of the decimal dot in the display is also set. After the wizard is used, the LI-19 only has to be programmed to make it suitable for use with the specified sensor.

Use the 'Select sensor' button to access the wizard. The Wizard accommodates many different sensors.

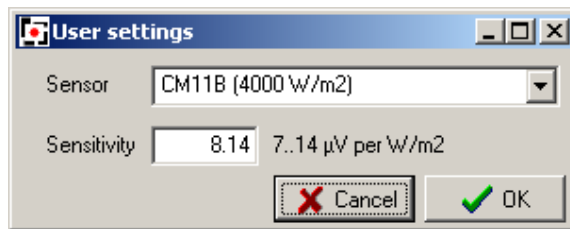

Use the wizard to select the sensor model that is to be used, and then enter the sensitivity of the sensor. The LI-19 is then ready to be programmed with the new settings. To do that, click the 'Program' button.

Data logger

The PC software is used to enter the data logger setup, and to transfer the setup to the LI-19.

When the LI-19 is programmed with a new datalogger setup, the logger memory in the LI-19 is erased, and then the new settings are used to start a new logging sequence. The logging only stops when the logger memory is full, when the batteries are depleted, or when the LI-19 is switched off. The PC software can be used to check the logging activities of the LI-19, and the LI-19 also shows some display characters to indicate what it is doing.

Log interval

The log interval is entered in seconds. The pull-down box can be used to preset the correct number of seconds for some popular log intervals. Note that the pull-down is only used for selecting a preset, the number on the left is the log interval that will be transferred to, and used by, the data logger in the LI-19.

Initial delay

When logging starts, an optional delay is used to postpone the start of the first logging interval until a specified date and time. This date and time at which the first interval will start, can be entered in the PC software. When the logger is busy counting down the delay for the first logging interval, the LCD on the LI-19 shows an 'I' that flashes at a slow (1 second on, one second off) rate.

Logging

Once the initial delay has elapsed (the initial delay can be 0) the first logging interval is started. The LI-19 is now actually logging, and the 'I' on the LCD flashes rapidly (½ second on, ½ second off)

Logged values

During a logging interval, the LI-19 accumulates minimum input value, maximum input value, and average input value. Once the logging interval has elapsed, the values are stored in the logger memory and the next interval is started. Each time the LI-19 stores a new set of values in the logger memory, it flashes the 'm' sign on the display. Logging only stops when the logger memory is full, when the batteries are depleted, or when the LI-19 is switched off.

Read status

You can view the logger status while the logger is active. Reading the status will not interfere with the logging process.

The status will show what the logger is doing, how much time remains in the current interval (if the logger is logging) and what the measured values are. The logger measures an integral over the logging interval. The PC software uses the integral and the interval period to calculate an average value over the logging interval.

Reading measured values from logger

Sensor settings | **Datalogger**

☒ View datalogger status

Status: Logging: 438 bytes stored.

Remaining interval: 1

Minimum	Integral	Maximum
7.587	220.071	7.59

Read the data from the datalogger

Data logger programming

Log interval (seconds): 30


Delay logging until: 15:33

Erase and start the datalogger


8 0 0%

Read data

Use the PC software to read the logger memory from the LI-19. You can do this while the LI-19 is logging, reading data will not interfere with the logging process. When the data from the logger memory is collected, it will be presented in a chart.

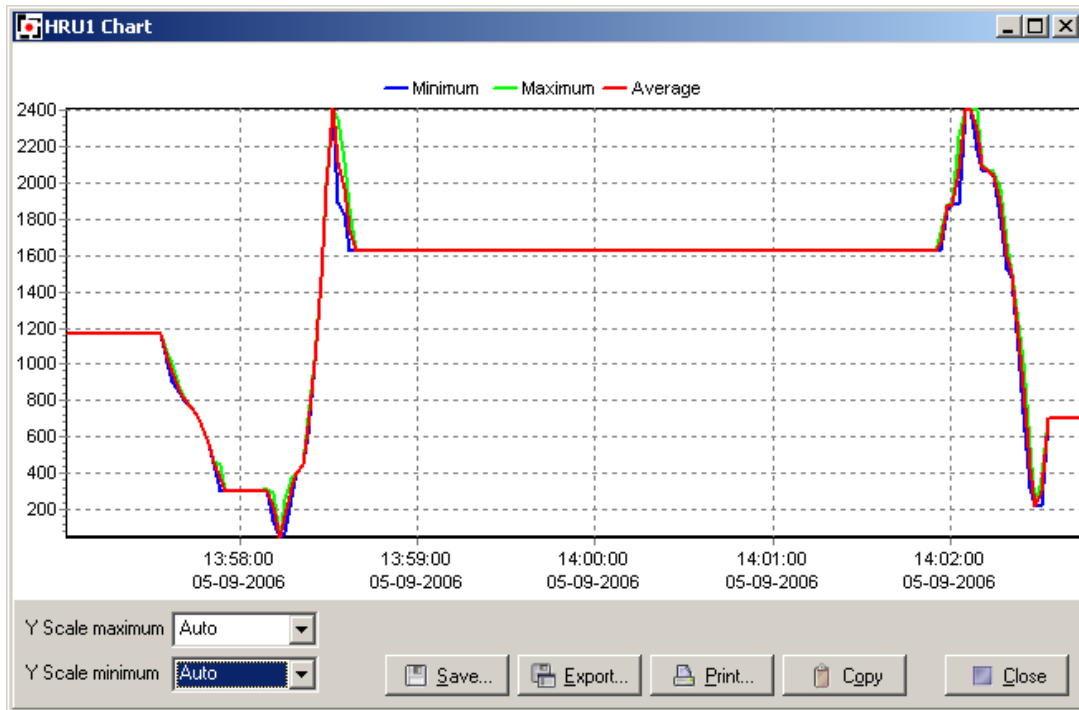


The Y scale can be manually set, and you can also use the mouse to zoom in on a specific area of the chart. Drag the mouse pointer from the top left corner of the area of interest, to the bottom right corner of the area of interest. When the mouse is released, the chart will zoom in on the selected area.

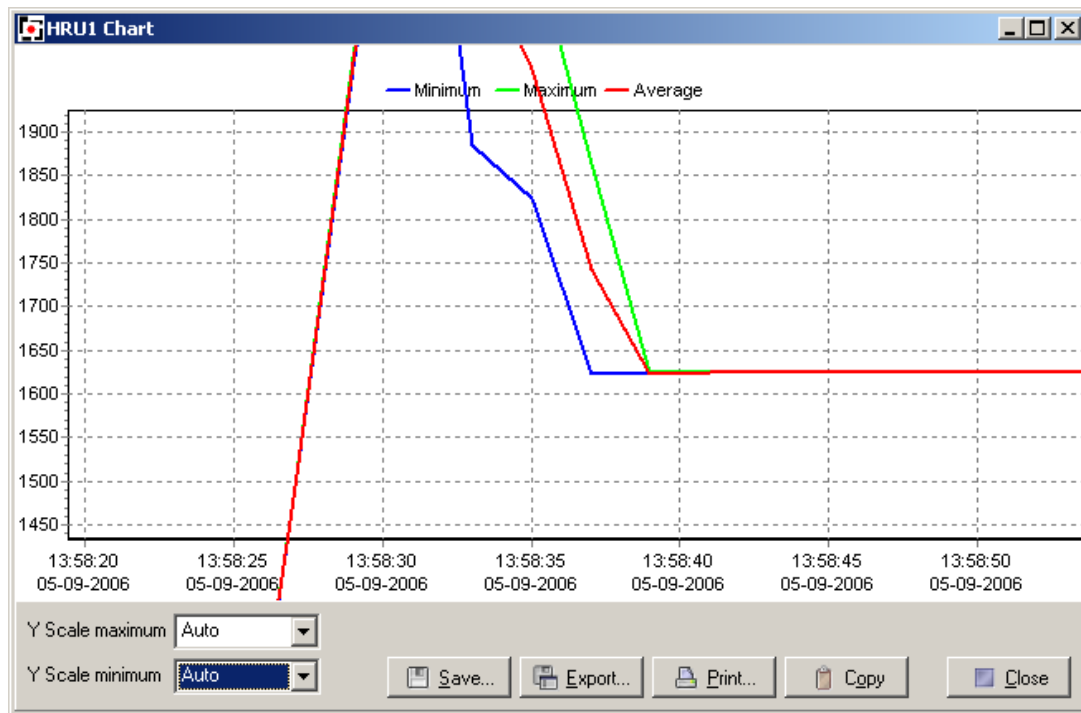

Drag the mouse from bottom right to top left to zoom out again.

Save the data in a logger data file, or export the data in a text format that can be imported in a spreadsheet.

Use the Copy button to place the chart on the clipboard, ready to be pasted into a word document.

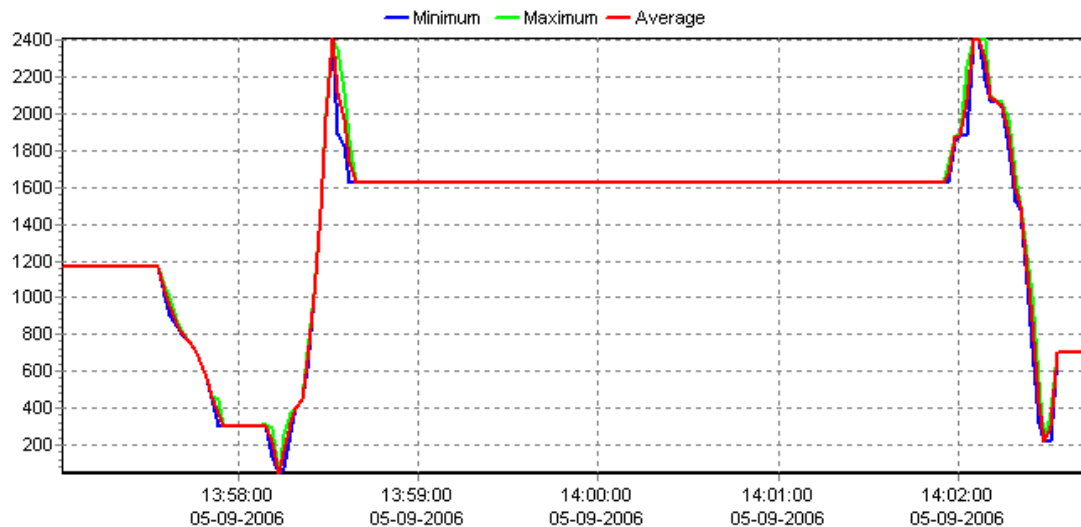

Leiderdorp Instruments

Dijkgravenlaan 17
NL 2352 RN Leiderdorp

The Netherlands

Phone: +31-71-5415514
Fax: +31-71-5418980

e-mail: info@leiderdorpinstruments.nl

www.leiderdorpinstruments.nl